



# PHOTO-ENGRAVING GLUE

## TECHNICAL NOTES

### Introduction

Most people are aware of animal gelatine products, but few know about fish gelatine, although this has been used as a photo-resist since the 1890s. Both products are obtained from a similar source – the skin. With animal gelatine, the usual source is the hide of cattle, although gelatine may be obtained from the skin of any other animal where sufficient quantities are to be found. With fish gelatine, the usual source is from cod.

Chemically speaking, both types of gelatine have the same basic constituents, although the proportions differ depending on the source.

The main difference between fish and animal gelatine is that a water solution of fish gelatine is liquid at room temperature, whereas the animal product is a solid. Both gelatines have other properties which are similar. They can be used as high strength glues. They make excellent bases as emulsions, and they can be made light sensitive by the addition of sensitisers, thereby finding use in photo-engraving processes.


Fish gelatine has been known since 1890 as photoengravers' glue. Photoengraving glue can be obtained in various degrees of purity, the gelatine grade being crystal clear. Since fish gelatine is a liquid at room temperature, it is easy to handle as a coating. Chromium salts (such as chromic acid, ammonium bichromate, potassium bichromate or ammonium chromate) can be added in varying proportions to make the gelatine sensitive to light. Exposure to light (especially actinic rays from an ultraviolet lamp source or from sun light) will insolubilise the gelatine, although the exact reaction is still not fully understood by chemists.

The use of photoengraving glue in a photo resist is based on the adaption of these properties; fish gelatine solutions can be made light sensitive, are easy to use as coatings, and on drying these coatings can be insolubilised with light. Further baking will convert the coating into an acid resistant polymer.

### Chemistry

Fish gelatine is a protein molecule consisting of a complex chain of 20 amino acids. The molecular weight of fish gelatine is estimated to be between 30,000 and 60,000. The specific properties of the molecule are dependent upon its molecular chain length and the reactive end groups that are on the molecule. These reactive groups are hydroxyl (OH), carboxy (COOH) and amino (NH<sub>2</sub>).

The photo hardening of dichromated colloid layers has been studied at some length over the past years. The literature contains considerable reference to various explanations. We would suggest that the photo hardening is the result of an oxidation-reduction reactions which is accelerated by light in the ultra-violet wavelength range. The oxidation-reduction equation for bichromate is as follows:



Under the action of light, the colloid is oxidised by the bichromate, and trivalent chromium is formed. Since trivalent metal ions will get a colloid, the resultant areas exposed to light will not wash away when the colloid layer is rinsed with water.

The sensitivity of the coating is dependent on the following:

- 1. The composition of the coating.**  
The composition requires a colloid which reacts with bichromate under ultra violet light and cross links with the resultant trivalent chromium to form a gel.
- 2. The thickness of the coating.**  
Since the light must penetrate and insolubilise the coating to the interface of the surface coated, the thickness is important. Otherwise there will be no adhesion.
- 3. The distance of the light from the coating**  
This determines intensity at the photo resist surface.
- 4. The wavelength of the light source**  
The light source must have a proper wavelength which is absorbed by the photo resist.

**HUNTER PENROSE SUPPLIES LTD**  
**32 SOUTHWARK STREET, LONDON, SE1 1TU**  
**0044 207 407 5051 FAX: 0044 378 1800**  
**[INFO@HUNTERPENROSE.CO.UK](mailto:INFO@HUNTERPENROSE.CO.UK) WEBSITE: [WWW.HUNTERPENROSE.CO.UK](http://WWW.HUNTERPENROSE.CO.UK)**



#### 5. The exposure time

The time of exposure (together with intensity) determine the total light energy.

In forming a dichromated colloid image on the metal surface, it is necessary to obtain a gelled image that will not readily wash away. Insufficient exposure will result in insufficient trivalent ions being formed. The resultant image will not form a hard gel but will swell and sluff off when washed with water. Sufficient exposure must be given so the image will not swell excessively upon washing, and then will dry down to a glossy coat.

The ratio of bichromate to colloid will also affect the sensitivity. For photoengraving glue, the ratio can be varied from 1 part ammonium bichromate/ 20 parts liquid glue (by weight as supplied) to 1 part ammonium bichromate 7 parts liquid glue. The sensitivity will increase as the bichromate concentration is increased, reaching a peak at about 1 part ammonium bichromate/ 10 parts liquid glue by weight. Additional bichromate concentration will reduce the sensitivity, because the light will not penetrate the coating as deeply.

Only a small percentage of the bichromate reacts with the colloid. The remainder is washed out during the image development step. However, the excess amount is necessary to obtain the proper sensitivity

### General properties of photoengraving glue

Photoengraving Glue is supplied at a 45% solids solution with a viscosity in the range of 4000-5000 centipoise, or similar to honey. The glue as supplied is protected with bactericidal agent that will give it a long shelf life. Preferred storage temperature is 75°F (24°C) or less, away from exposure, to heat or direct sunlight.

Like all colloid solutions, the viscosity is dependent upon temperature. Photoengraving glue becomes more viscous as the temperature is reduced, and will form a gel at temperatures below 50°F (10°C). If the cold or gelled glue is heated to room temperature, the viscosity will return to normal with no chemical change. If the glue arrives frozen or gelled because of winter temperatures, store at room temperature for a day before use so that it can be poured out of the container.

Photoengraving glue is a protein that is an excellent food for bacteria. The glue as supplied is protected. Diluting will reduce the effectiveness of the preservative and non-sterile water will provide the bacteria culture necessary to start a vigorous growth within a few days. The addition of bichromate will act as a preservative, and effectively stop

any bacterial action. The above is pointed out so that the user will not predilute large quantities of photo engraving glue. Dilute only enough to make the photo resist.

### Mixing of the resist

To make a photo resist, photoengraving glue must be diluted with water to give the proper coating viscosity. Sensitiser is then added, with any additional ingredients which are described further on.

Here is a good starting formula:

Photoengraving glue	27%
Water	70.3%
Ammonium Bichromate	2.7%

To mix, dilute the glue with water using a stirrer, Add the ammonium bichromate, and allow enough time for the mixture to dissolve the bichromate while stirring

The above formula is based on weight percentages, and will give a total solids of approximately 15%. The viscosity range will be 10-12 centipoises. This is a good range for either whirler coating or dip coating

The pH of the photo resist will be 5.5-5.6. The solution will have a shelf life of 4-7 days depending upon the storage temperature. At a temperature of 65-70°F(18-20°C) is generally preferred. Higher temperatures will reduce the shelf life.

The photo resist should be filtered before use, and allowed to stand to remove air bubbles. We use a 5 micron cartridge filter which gives excellent results. If finer filtration is required, microporous filters are available to remove particles as small as 1 micron

Store the photo resist in a stainless steel container, or a dark plastic container, away from bright light. The photo resist is not very sensitive to visible light, but preferably should be handled in yellow light.

The amount of water added can be varied, to give a particular viscosity for a specific coating procedure. Although a heavier coating will offer more acid resistance, more light is required to insolubilise a thick coating. In most cases a thin coating gives adequate resistance

With any bichromated colloid solution, there is a possibility of limited shelf life because of the "dark reaction" between the bichromate and the colloid. Temperature, concentration of the bichromate, concentration of the colloid, and pH all affect the dark reaction. The viscosity will gradually increase and the mixture becomes progressively more light sensitive. Eventually the coating

**HUNTER PENROSE SUPPLIES LTD**  
**32 SOUTHWARK STREET, LONDON, SE1 1TU**  
**0044 207 407 5051 FAX: 0044 378 1800**

**INFO@HUNTERPENROSE.CO.UK WEBSITE: WWW.HUNTERPENROSE.CO.UK**



will not wash away cleanly and will leave a scum on open areas which should be absolutely clean.

It is possible to increase the shelf life by neutralizing the mixture to a pH of 6.8-7.0 with ammonium hydroxide. Sensitivity of the mixture will be reduced, but the shelf life will be greatly extended to a month at least. Do not use any other alkaline material in place of ammonium hydroxide.

If additional sensitivity is required, we recommend adding dilute sulphuric acid to the original formula and reducing the pH to 5.0. This will decrease the printing time and also decrease the shelf life. Use a 5-10 per cent solution of sulphuric acid and add it slowly to the photo resist while it is being stirred

### **Cleaning the surface to be coated**

To obtain maximum adhesion of the photo resist, the metal surface must be chemically clean and water wettable. Either one or a combination of the following methods can be used:

- 1 Abrasion - using a pad with or without pumice.
- 2 Soaking the sheet in a water based cleaning agent (usually at high temperatures),
- 3 Electrolytic cleaning.
- 4 Pre-etching with an etchant.

We do not recommend vapour degreasing except to remove excessive amounts of oil before one of the above steps

Some of the above methods will change the surface finish of the metal. The specific surface requirements of the finished part may well determine the cleaning method used

A good way to test the cleanliness of the sheet is to wet with water and then drain. The surface should hold a film of water for at least 30 seconds and preferably one minute, without the formation of voids

Most metal cleaning agents are alkaline. If an alkaline cleaner is used, the cleaned sheet should be dipped into a dilute acid solution (5% nitric acid) then rinsed. The photo resist will have poorer adhesion to an alkaline surface and so such a surface should be neutralized. We recommend a final rinse with deionised water after any cleaning step. If drying is necessary, dry in a clean atmosphere. Either room temperature drying or oven drying can be used

Water based photo resists have excellent adhesion to clean metal with a water wettable surface. If the photo resist flakes off during drying or the later post bake step the metal was not cleaned properly

Sometimes the method of cleaning will affect the surface of

the metal and reduce the rate of etching. If you use a chemical or electrolytic cleaning method, compare it initially against the abrasion method. Clean separate places of metal by each cleaning method, and then immerse the cleaned metal in the etchant. The metal cleaned by abrasion with pumice should etch readily. The metal cleaned by the other method should etch almost as readily, but not quite as readily - check the chemicals used, to determine what is leaving a residual deposit

### **Coating of the resist**

On most continuous in-line production equipment the water based photo resist is flow coated onto the wet strip displacing the rinse water from the metal for dip coating of single sheets, the metal to be coated should be dry. Note that trace amounts of moisture can be tolerated

For dip coating, the speed of withdrawal will determine the coating thickness. A slow withdrawal speed (4-6 inches per minute) will give an acceptable coat with the photo resist formulation supplied. A faster withdrawal (up to 12 inches per minute) will provide a thicker coating but will also take longer to dry and to expose or print. Drying time will be 5-15 minutes at 150°F (65°C). At the higher speeds, the coating thickness will be greater at the bottom than at the top, because of the run off of the photo resist. The slower speed will give a coating thickness of 2.5 to 3 microns. The higher speed will give a coating up to 5 microns,

Too thin a coating thickness will show as an iridescent fringe on the top of the coated sheet. This is more apt to happen on a very smooth and glossy metal surface. If the coating thickness is too thin, the photo resist will break down prematurely during the etching cycle.

In any coating operation, steps should be taken to eliminate bubbles. Any violent mixing or pouring of the photo resist may result in an air bubble forming. In dip coating, these will be attracted to the metal sheet as it is withdrawn and result in a coating flaw. Careful control of any pumping or circulating device will keep the bubbles to a minimum. When starting to dip coat, the first plates will generally clean out any residual bubbles which are in the tank

### **Drying of the resist**

As mentioned before, a drying time of 5-15 minutes at 150°F (65°C) is usually sufficient. A lower temperature can be used, and the sheet can be checked for dryness by touching a bottom corner

Too high a temperature can heat fog the resist. High temperatures accelerate the sensitizer in the resist, causing the coating to go blind. The printed image will not develop

Either convection heat or infra red heat can be used. A wet bead at the bottom of the sheet after drying can be wiped

**HUNTER PENROSE SUPPLIES LTD**  
**32 SOUTHWARK STREET, LONDON, SE1 1TU**  
**0044 207 407 5051 FAX: 0044 378 1800**  
**[INFO@HUNTERPENROSE.CO.UK](mailto:INFO@HUNTERPENROSE.CO.UK) WEBSITE: [WWW.HUNTERPENROSE.CO.UK](http://WWW.HUNTERPENROSE.CO.UK)**



off, or cut off. Longer drying time will also eliminate the wet bead, and a temperature of 150°F or less will not harm the resist.

### Exposure

The light energy to insolubilise the resist film is much greater than that required for silver halide photography. Light in the the yellow wave length will have little effect on the resist film. Ultra violet wave length has the most effect with a maximum adsorption in the 3200-3800 angstrom wave length

Time of exposure is dependent upon the source of light and distance between the resist coating and light. Here are some examples of exposure times for a coating thickness of standard sensitivity:

LIGHT SOURCE	DISTANCE	TIME
15 amp single arc	15 inches	6 minutes
95 amp single arc	48 inches	4 minutes
4500 watt pulsed xenon	36 inches	4 minutes
8000 watt pulsed xenon	10 inches	30-45 seconds

Reducing the distance or increasing the time will both increase the amount of exposure. Cutting the distance in half will have the same effect as quadrupling the exposure time.

Exposure is carried out using a vacuum frame which will draw the negative in close contact to the resist film. The emulsion side of the negative should be next to the coated sheet, to provide absolute contact of the print to the resist.

The density of the negative is very important. Lines black to the eye may be translucent to the light source, and the lamp will print through the negative where the lines are supposed to block out the light

### Development of the photo resist

The exposed image is next washed with room temperature water. The unexposed portions will wash out quickly and completely. This feature makes the water based system very safe to handle. It eliminates the cost, handling, storage, and disposal of hazardous solvents

Long washing periods are not necessary. The image should wash clean in a minute, less if a fine spray is used. In using a spray, normal water line pressure is adequate,

but this should be controlled if there is any large fluctuation. A water temperature of 75-85°F (24-29°C) is recommended. Although temperatures up to 100°F (38°C) are used, we would avoid any water temperature in excess of this, Too high a temperature can swell the resist image.

If it is desired to visually inspect the image, it can be dyed with a water soluble dye. Use 5 grams of water soluble methyl violet dye in a gallon of water. Immerse the developed sheet in the dye solution for 15-20 seconds. Remove and rinse with tap water.

To dry, the sheet may be blown dry with a stream of compressed air, whirled dry or allowed to dry in warm air

### Burn-in

To obtain acid resistance, the image must be baked at a temperature of 500-550°F for 5-10 minutes. This is best done in a heated oven, as the polymerization is the result of an oxidation step and requires air. One word of caution is necessary. Do not develop the image and place it wet into the hot oven. The sudden expansion of steam will blister the photo resist and reduce the acid resistance of the image. The wet image must be dried before it is placed in the burn-in oven

In an in-line operation where a continuous sheet is being processed, it is possible to go from the developing step into the hot oven. This is because of the distance between the two stations, and because the air between the two stations is heated by the circulating air escaping from the oven. The wet photo resist is thus dried before it enters the hot oven.

The high temperature bake will darken the photo resist image and give an indication of the extent of polymerization. Such factors as colour of the metal and thickness of the resist also affect the apparent colour of the image, but once the proper conditions are determined, the check can be visual. The colour should be between a tan and a light brown. Too light a colour will show insufficient polymerization. A colour approaching black will show too high a temperature resulting in charring and breakdown of the photo resist. Either of these conditions are caused by temperatures outside the 500-550°F range. (2600 -288°C).

We have found that as the time of bake is increased, the acid resistance increases until it reaches a plateau. The higher temperature (550° or 288°C) will give somewhat better acid resistance and will likewise be more difficult to remove.

A temperature lower than 500°F for a longer time will not polymerize the resist. A temperature of at least 500°F (260°C) is necessary.

### Etching solution

Ferric chloride is the preferred etchant for metals commonly processed. The best etching characteristics are obtained using 480 baume ferric chloride at 120°F (49°C). Speed of this etchant can be increased by raising the temperature up to 170°F (77°C). Faster etching speeds are

**HUNTER PENROSE SUPPLIES LTD**  
**32 SOUTHWARK STREET, LONDON, SE1 1TU**  
**0044 207 407 5051 FAX: 0044 378 1800**

**INFO@HUNTERPENROSE.CO.UK WEBSITE: WWW.HUNTERPENROSE.CO.UK**



obtained by using the more dilute 42° baume ferric chloride. However, a more ragged edge is obtained on many metals.

### Stripping

After etching, the resist can be readily dissolved and thoroughly stripped by immersing the sheet for 30-60 seconds in a 5-10% water solution of caustic soda (sodium hydroxide) heated to 160-180° F(72-82°C). Care should be taken so that the caustic is not splashed on the skin or in the eyes.

### Safety precautions

Although bichromates, acids, and alkalis are used in many production processes every day, we wish to point out that care should be exercised to avoid contact of these materials with the skin and eyes. A good safety procedure is to use rubber gloves and rubber apron when handling these materials and safety goggles when there may be danger of splashing.


Photoengraving glue is non-toxic by itself, but the bichromated resist should be handled in such a manner as to avoid undue skin contact.



Hunter Penrose Supplies Ltd  
32 Southwark Street  
London, SE1 1TU  
0207 407 5051  
info@hunterpenrose.co.uk  
website: www.hunterpenrose.co.uk

For high quality  
printmaking  
equipment call  
**Hunter Penrose**

- etching presses
- aquatint booths
- fume cupboards
- sinks and benches

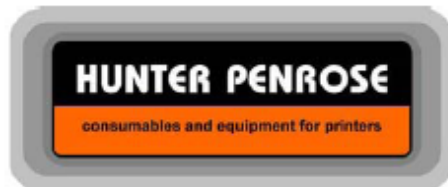

**HUNTER PENROSE SUPPLIES LTD**  
**32 SOUTHWARK STREET, LONDON, SE1 1TU**  
**0044 207 407 5051 FAX: 0044 378 1800**  
**INFO@HUNTERPENROSE.CO.UK WEBSITE: WWW.HUNTERPENROSE.CO.UK**